

TECHNICAL SERVICE BULLETIN

| by Duy GIS www. | | | | | |
|------------------------|---|--------|---------------|---------|---|
| NUMBER | 16TSB-28 | TYPE | SERVICE ALERT | | |
| TITLE | BLINKING CONTROLLER LIGHT (MD/HD/EX/CM) | | | | |
| REV | Α | ISSUED | 10/7/2009 | REVISED | - |
| AFFECTS | SOME STRAIGHT BLADE INSTALLATIONS ON 2009-2010 SEASON PLOWS | | | | |
| INFORMATION | THE PLOW SIDE HARNESS HAD 3 NON-FUNCTIONAL PINS ADDED TO SUPPORT OTHER APPLICATIONS FOR THIS HARNESS. THE BACKFEEDING THROUGH THESE PINS MAY CAUSE THE CONTROLLER TO DETECT A FAULT WHERE NONE EXISTS. | | | | |
| IDENTIFICATION | THE CONTROLLER SHOWS A RED BLINKING LIGHT. 3 WHEN UP IS PRESSED. 4 WHEN RIGHT IS PRESSED, ETC. THE PLOW FUNCTIONS NORMALLY. THE PLOW SIDE HPU HARNESS HAS 2 LARGE AND 6 SMALL PINS. | | | | |
| INSTRUCTIONS | A SERVICE PART (16160602) IS AVAILABLE THAT IS INSTALLED BETWEEN THE CONTROLLER AND THE HARNESS (UNDER THE DASH). - UNPLUG THE CONTROLLER - ATTACH THE ADAPTER TO THE CONTROLLER - RECONNECT THE CONTROLLER CONTACT BPC CUSTOMER SERVICE TO ORDER 16160602 AT NO CHARGE. THIS WILL BE AVAILABLE FOR SHIPPING BY 10/15. IF REQUESTED, IT CAN BE DROP SHIPPED DIRECTLY TO AN END USER (IT IS EASILY INSTALLED). | | | | |