




TECHNICAL SERVICE BULLETIN

NUMBER	16TSB-42	TYPE	SERVICE/INSTALLATION ALERT		
TITLE	16013000 VX POWER UNIT				
REV	A	ISSUED	12/22/2010	REVISED	-
AFFECTS	16013000 - VX SERIES PLOWS				
INFORMATION	THERE ARE DEALER REPORTS OF IMPROPERLY TIGHTENED PLUGS ON THE VX HYDRAULIC UNIT RESULTING IN LEAKAGE. THIS SEEMS TO BE PRIMARILY 2010 VX'S (S/N 2800+, BUT IT IS RECOMMENDED THAT ALL BE CHECKED)				
INSTRUCTIONS	AT INSTALLATION, OR AT THE FIRST AVAILABLE SERVICE OPPORTUNITY, ALL ACCESSIBLE O-RING PLUGS (SHOWN ABOVE) ON THE VX POWER UNITS SHOULD BE TIGHTENED BY THE INSTALLER. IF LEAKING, THE PLUGS (OR O-RINGS IF AVAILABLE) SHOULD BE REPLACED. THE PLUGS SHOULD BE TORQUED TO 2-3 FT-LBS (SNUG). THE REPLACEMENT PLUG PART NUMBER IS 16152016.				