
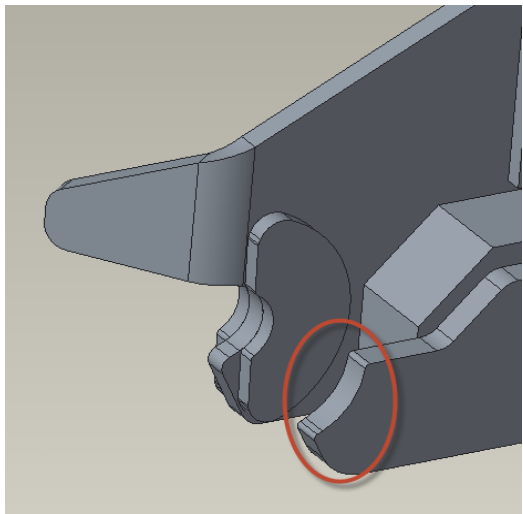


SnowDogg

by **Buyers**

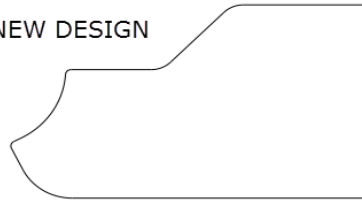

TECHNICAL SERVICE BULLETIN

NUMBER	16TSB-64			TYPE	SERVICE/INSTALL ALERT			
ROUTING	INSTALL	X	SERVICE	X	SALES		PURCH	
TITLE	MD MOUNTING INTERFERENCE							
REV	B			ISSUED	11/9/2015		REVISED	11/2/2016
AFFECTS	SOME MD LIFTFRAMES (16015000) / PUSHBARS							
INFORMATION	SOME MD MOUNT PUSHBARS SOLD IN 2015 HAD EXCESSIVE WELD MAKING MOUNTING DIFFICULT AS THE LIFTFRAME EARS COULD NOT LOCATE PROPERLY ON THE PUSHBAR.							
DETECTION	AT TIME OF PLOW MOUNTING OR VISUAL INSPECTION AT MOUNT INSTALLATION							
CORRECTION	<p>THE PREFERRED REWORK FOR THIS IS TO MODIFY THE PLOW LIFT FRAME - REMOVING A SMALL AMOUNT OF MATERIAL AS SHOWN. THAT TAB IS NOT USED FOR MOUNTING OR STRENGTH AND CAN BE REMOVED/MODIFIED.</p> <p>THE PRODUCTION DESIGN HAS BEEN CHANGED TO ELIMINATE THIS ISSUE.</p> <p>CONTACT SNOWDOGGTECH@BUYERSPRODUCTS.COM WITH ANY QUESTIONS.</p>							
	<p>NEW DESIGN</p> 				<p>OLD DESIGN</p> 