



TECHNICAL SERVICE BULLETIN

NUMBER	16TSB-81			TYPE	SERVICE ALERT			
ROUTING	INSTALL	X	SERVICE	X	SALES		PURCH	
TITLE	SWITCHED GROUND INSTALLATION - G2 HARNESS							
REV	A			ISSUED	10/31/2018	REVISED	-	
AFFECTS	16011002/16012002/16013002 G2 LIFT FRAMES							

INFORMATION
 There have been reports of miswired relay harnesses in the field. This does not affect normal installations - **but does affect switched ground installations**. The below instructions should clarify any steps that need to be taken. Verify your harnesses against the figures below, and if necessary correct the wiring.

Current production harnesses should have the BLACK wire paired with the BLACK/WHITE wire as shown in the pictures. If you have BLACK paired to BLACK - the controller fuse (or the fuse will tapped into) will blow. Swap the BLACK and WHITE/BLACK wires on the RELAY BOX HARNESS. *While you CAN swap the wires on either connector, the relay box harness is easier.*

