



TECHNICAL SERVICE BULLETIN

NUMBER	16TSB-86			TYPE	SERVICE ALERT					
ROUTING	INSTALL	X	SERVICE	X	SALES	PURCH				
TITLE	G2 CHAINLIFT CYLINDER PIN DAMAGE - DISTRIBUTE IMMEDIATELY TO ALL INSTALLERS AND AFFECTED PLOW OWNERS									
REV	A			ISSUED	12/7/2018		REVISED	-		
AFFECTS	ALL SNOWDOGG G2 PLOWS - HD2/EX2/VXF2/TE2 - PRIMARILY VXF2									


INFORMATION

We've received reports of the cotter pin on the chainlift/cylinder clevis pin failing. If not detected, this can cause the clevis pin to come loose and the cylinder to **cause further damage to the plow/lift frame.**



TEMPORARY FIELD SOLUTION

REMOVE THE ANTI-ROTATION PLATE. The plow will function normally but premature wear of the clevis pin or chain lift may result.

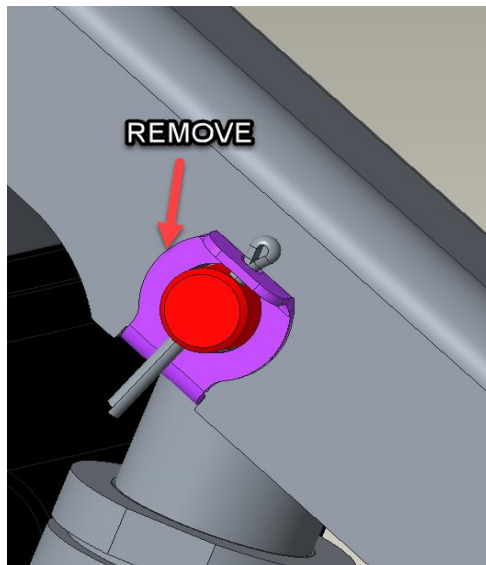

PERMANENT CORRECTION

Replace the anti-rotation plate and cotter pin with part number 16111402A. This is an anti-rotation plate with a alloy steel socket head screw. The #10-24 x 1.50 screw is readily available at most hardware stores.

16111402A will be available by 12/12/18 for order and will be treated as a warranty item. All plows in stock and previously sold should be updated to this kit.



CORRECTION