



TECHNICAL SERVICE BULLETIN

NUMBER	16TSB-60			TYPE	SERVICE/INSTALL ALERT			
ROUTING	INSTALL	X	SERVICE	X	SALES	PURCH		
TITLE	HYDRAULIC POWER UNIT STUDS VIBRATING LOOSE							
REV	A			ISSUED	3/11/2014	REVISED	-	
AFFECTS	ALL PLOWS SHOULD BE INSPECTED WHEN IN FOR SERVICE							
INFORMATION	THERE HAVE BEEN REPORTED AND CONFIRMED CASES OF THE THREAD LOCKER USED ON THE HYDRAULIC POWER UNIT STUDS NOT CURING PROPERLY. THE STUDS CAN VIBRATE LOOSE, RESULTING IN A LOOSE POWER UNIT. PLOWS SHIPPED AFTER 3/11/2014 ARE USING A DIFFERENT SEALANT AND SHOULD NOT REQUIRE INSPECTION.							
INSTRUCTIONS	<p>THE STUDS CAN BE RETIGHTENED USING 2 NUTS (JAMNUT CONFIGURATION) TO APPROXIMATELY 15 FT-LBS. DO NOT USE VICE GRIPS. ALTERNATELY THE STUDS MAY BE REMOVED AND PERMANENTLY REPLACED WITH 3/8-16 x 1" BOLTS (FCS038016100) AND LOCKWASHERS (FWL038069009).</p> <p>ALL PLOWS, WHEN BROUGHT IN FOR SERVICE SHOULD BE INSPECTED AND THE STUDS CHECKED AND TIGHTENED.</p> <p>CONTACT SNOWDOGGTECH@BUYERSPRODUCTS.COM WITH ANY QUESTIONS.</p>							