



TECHNICAL SERVICE BULLETIN

NUMBER	16TSB-69			TYPE	SERVICE ALERT			
ROUTING	INSTALL	X	SERVICE	X	SALES		PURCH	
TITLE	2015-2016 FORD SUPER DUTY - ERRATIC PANEL ILLUMINATION							
REV	A			ISSUED	12/27/2016	REVISED	-	
AFFECTS	2015-2016 FORD SUPER DUTY INSTALLS							
INFORMATION	<p>FORD HAS ISSUED A DEALER ALERT COVERING THIS ISSUE.</p> <p>SSM 46236 - 2015-2016 F-Super Duty - Erratic Panel Illumination Of Radio, Climate Control And/Or IPC When Using Up-fitted Accessories With High Electrical Loads</p> <p>Some 2015-2016 F-Super Duty vehicles built on or after 08/22/2014 and up-fitted with high electrical load accessories such as a snow plow or winch may exhibit erratic panel illumination of the radio, climate control and instrument panel cluster (IPC) when the customer operates the up-fitted accessory. The body control module (BCM) response to excessive voltage spikes may be the cause. Reprogram the BCM to the latest calibration using IDS release 103.02 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at www.motorcraftservice.com. Use causal part 15604 and applicable labor operations in section 10 of the service labor time standards (SLTS) manual.</p> <p>APPLICABLE VEHICLES 2015 - 2016 TRUCK: FA P473 SUPER DUTY</p>							
CORRECTION	TRUCKS AFFECTED SHOULD BE TAKEN TO A FORD DEALER FOR REPROGRAMMING PER THE ALERT - SSM46236							