

TECHNICAL SERVICE BULLETIN

by Buyers mm								
NUMBER	16TSB-103			TYPE	SERVICE ALERT			
ROUTING	INSTALL	Х	SERVICE	Х	SALES	PURCH		
TITLE	GMC/CHEVY TRUCK INSTRUMENT CLUSTER/RADIO BEHAVIOR							
REV		-		ISSUED	11	/21/2022	REVISED	
AFFECTS	2014+ GMC/Chevy Pickup Trucks							
INFORMATION	GM has released several bulletins about erratic truck instrument panel behavior when used with a snowplow These may be found at gmupfitter.com under 161B and 124K and are attached for your convenience.							
	https://www.gmupfitter.com/wp-content/uploads/2021/08/UI-Bulletin-161b.pdf https://www.gmupfitter.com/wp-content/uploads/2021/05/UI-Bulletin-124k.pdf							
INSTRUCTIONS	If a truck exhibappropriate ha		e symptom:	s, contact	your GMC/	Chevrolet deale	to have yo	ur truck updated with the

General Motors Upfitter Integration

UI Bulletin #161b









Intermittent Cluster, Radio and HVAC Display

Subject: Resets on Snow Plow Trucks

Models/Years 2020 – beyond Chevrolet Silverado 2500-3500 HD

Affected: 2020 - beyond GMC Sierra 2500-3500 HD

With Snow Plow Prep Package (RPO VYU)

Origination January 16, 2020

Date:

February 8, 2021

Date:

Revision

ADVISORY:

Condition/Concern:

Some trucks equipped with option VYU [Snow Plow Prep] and a snow plow, may exhibit occurrences in which the Instrument Panel Cluster (IPC), Radio and HVAC displays may "blank out" or reset after changing the snow plow position. This condition is caused by a system voltage over-shoot phenomenon called 'load dump'. When the large electrical draw of the plow pump motor is suddenly removed the field energy that is built up in the alternator causes a system voltage overshoot that momentarily moves above the normal design operating levels for the module displays. As a result, the displays will shut down or reset causing the momentary blank out condition. The modules are designed to do this and immediately recover. *No modules* should be replaced for this condition.

Repair/Recommendation:

Contact your local GM Dealer for an appointment to install **P/N** is **84731643 (HD only) VYU Snow Plow Jumper harness** per the latest version of **GM Service Bulletin PIT5387G.** If your truck has RPO VYU and did not come with the harness parts they may be ordered by your dealer.

Note: This jumper harness and installation will be provided [one time] without charge. Installation charges will be waived only if the jumper is installed at your GM dealer.

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #161b P a g e 1 Rev Date: February 8, 2021










Installation Instructions:

1) Locate and drill holes (9.0mm) for the mounting location of the mini electrical center per figure (TBD). Use the mounting bracket as a template for holes as shown in figure TBD Be sure to use a drill suitable for high strength steel and a lubricating oil/fluid


2)

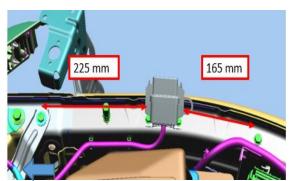



- 3) Once drilled holes are completed install the 2 riv-nuts included in the kit (see figure TBD) using GM Special Service Tool BO-42151-6MM-KIT or equivlent (shown in figure TBD) as follows:
 - a) Apply lubricant to bolt threads. Insert bolt (4) through washer (3) and anvil (2) into rivet nut (1) until finger tight.
 - b) Insert rivet nut assembly into hole in sheet metal.
 - c) Hold anvil (6) with 9/16" wrench and tighten bolt (5) with 10 mm wrench to crimp the rivet nut approximate 3 turns. *Do not over tighten.*
 - d) Remove bolt, washer and anvil.



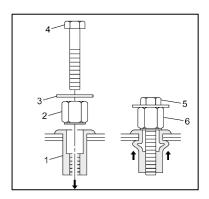

4) Remove Air Cleaner Outlet Duct (Figure TBD) per GM Service Information Link below.

Air Cleaner Outlet Duct Replacement



General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #161b Page 2 Rev Date: February 8, 2021










5) Using the supplied 6mm bolts, loosely install the bracket for the mini electrical center such that center retaining tab faces outboard from the flanged edge (refer to figure TBD).



6) After you have installed the bracket, attach the relay box to the bracket mount



7) Using 2 of the supplied combination tie strap/clip retainers, route and secure as shown in figure TBD.

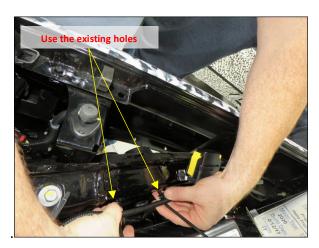

General Motors Upfitter Integration

http://www.gmupfitter.com

Page 3 Bulletin #161b Rev Date: February 8, 2021











8) Continue routing and securing the wiring harness using the combination tie strap/clips provide. Secure to the center radiator support bracket as shown in figure TBD

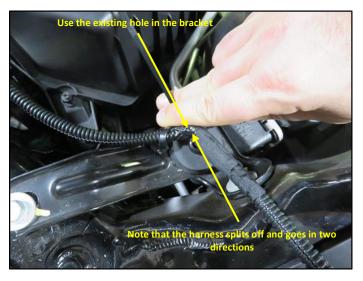

9) In figures TBD it is shown the harness splits off in 2 different directions. The large bundle will be routed across and secured using the tie strap/clips to the 6.5mm holes that are needed to be drilled into the cooling fan shroud as shown in figure TBD

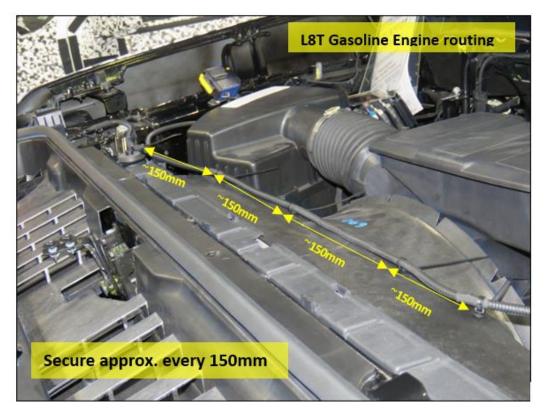

General Motors Upfitter Integration

http://www.gmupfitter.com


Page 4 **Bulletin #161b** Rev Date: February 8, 2021









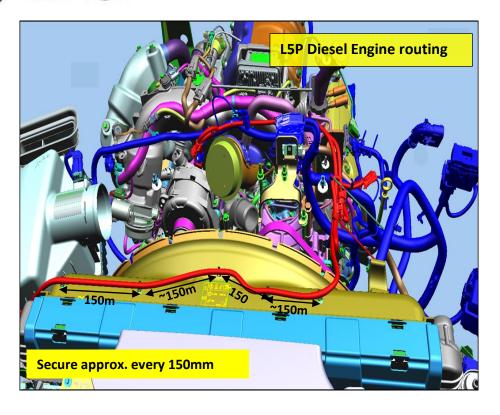

10)

11) The smaller bundle is routed beneath the air baffle

12) Single generator systems:

- a) Unplug the 2-way connector on the generator. (Figure 1)
- b) Identify the master generator connector [at the very tip of the harness when it is fully extended]. Insert it in the alternator.
- Take the original alternator connector and plug it into the mating jumper harness connector.
 Note: In this case the second alternator connector will be unused and will remain capped and tied to the harness bundle.

13) Dual generator systems:

- a) Unplug the control connectors on both alternators.
- b) Identify the master alternator connector [at the very tip of the harness when it is fully extended]. Insert it in the 'master' alternator on the RH side of the engine.
- c) Identify the 'slave' alternator connector on the jumper harness and insert it in the LH 'slave' alternator. Insert the removed LH alternator connector into the [unwired] cap on the jumper harness.


General Motors Upfitter Integration


http://www.gmupfitter.com

Bulletin #161b P a g e 5 Rev Date: February 8, 2021

General Motors Upfitter Integration

UI Bulletin #161b

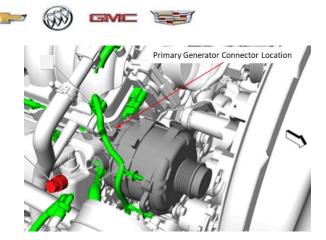


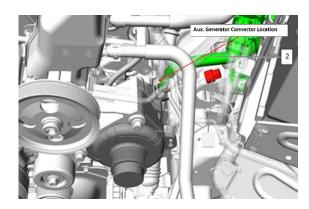


14) Remove the Intake Air Baffle per the service replacement procedure (link provided below)

Intake Air Baffle Replacement

15) Route the two wires of the harness such the taped portion is located as shown in figure (TBD) when the Intake Air Baffle is reinstalled. Route the harness with the connector and blunt cut wires out through the front grill like figure (TBD)

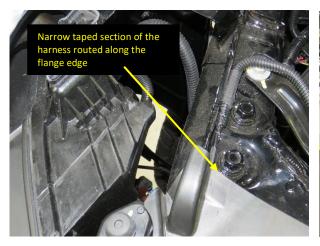

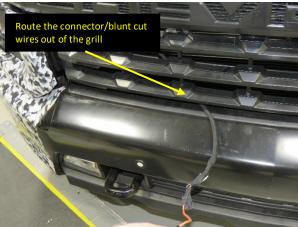

- 16) Reinstall all removed components.
- 17) The blunt wires will need to have the orange colored wire connected to power source that is active went the snow plow is being operated (moved) and the black wire to a ground source. This enables the relay to open the generator control circuit resulting on the generator operating at a base charging voltage and all but eliminating the "blank" condition of the vehicle control modules.

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #161b P a g e 6 Rev Date: February 8, 2021



Intermittent Cluster, Radio and HVAC Display

Subject: Resets on Snow Plow Trucks

Models/Years 2014 - 2018 Chevrolet Silverado 1500 LD

Affected: 2015 - 2019 Chevrolet Silverado 2500-3500 HD

2014 - 2018 GMC Sierra 1500 LD

2015 – 2019 GMC Sierra 2500-3500 HD With Snow Plow Prep Package (RPO VYU)

Origination November 30, 2015

Revision November 7, 2019

ADVISORY:

Notice: GM Dealers refer to the latest version of Service Information PIT#5387 for labor code/time information

REVISED TO UPDATE MODEL YEAR COVERAGE

Condition/Concern:

Trucks equipped with option VYU [Snow Plow Prep] and a snow plow, may exhibit occurrences in which the Instrument Panel Cluster (IPC), Radio and HVAC displays may "blank out" or reset after changing the snow plow position. This condition is caused by a system voltage over-shoot phenomenon called 'load dump'. When the large electrical draw of the plow pump motor is suddenly removed the field energy that is built up in the alternator causes a system voltage overshoot that momentarily moves above the normal design operating levels for the module displays. As a result the displays will shut down or reset causing the momentary blank out condition. The modules are designed to do this and immediately recover. *No modules* should be replaced for this condition.

Repair/Recommendation:

Contact your local GM Dealer for an appointment to install PN 84288774 VYU Snow Plow Jumper harness per the latest version of GM Service Bulletin PIT#5387. If your truck has RPO VYU and did not come with the harness parts they may be ordered by your dealer.

Note: This jumper harness and installation will be provided [one time] without charge. Installation charges will be waived only if the jumper is installed at your GM dealer.

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #124k Page 1 November 7, 2019



Installation Instructions

1) Single alternator systems:

- a) Unplug the 2-way connector on the alternator.
- b) Identify the master alternator connector [at the very tip of the harness when it is fully extended]. Insert it in the alternator.
- c) Take the original alternator connector and plug it into the mating jumper harness connector.
 Note: In this case the second alternator connector will be unused and will remain capped and tied to the harness bundle.

2) Dual alternator systems:

- a) Unplug the control connectors on both alternators.
- b) Identify the master alternator connector [at the very tip of the harness when it is fully extended]. Insert it in the 'master' alternator on the RH side of the engine.
- c) Identify the 'slave' alternator connector on the jumper harness and insert it in the LH 'slave' alternator. Insert the removed LH alternator connector into the [unwired] cap on the jumper harness.

3) All systems:

a) Service part [early] version:

i) Route the snow plow jumper harness along the existing harness routing where possible and secure the relay center with tie straps as shown in Details 3.1.1-3. Allow slack for engine roll and upright orientation of the relay center to prevent water intrusion/collection.

b) Factory shipped version [parts bag included with new vehicle]:

- i) Remove the harness and loose parts from the shipping bag/container. Locate the new corner brace pn 84234282 [it should be painted black but our pictures are of an unpainted part] and the nuts and bolts that will be used to attach the relay center portion of the harness.
- ii) For a complete picture book sequence for the installation see Details 3.2.1-7.
- iii) Route the snow plow jumper harness along the existing harness routing where possible and allow slack sufficient to secure the relay center to the [new flat] corner brace with the nuts and bolts included in the parts bag.
- iv) Remove the Radiator Air Upper Baffle and Deflector by unclipping it from the radiator.
- v) Remove and discard the LH front pencil brace as shown and install the new flat corner brace.
- vi) Attach the relay center to the corner brace and the brace top the truck as shown.

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #124k P a g e 2 November 7, 2019



4) All systems final [signal] connection:

- a) An operating signal must be identified to operate the small relay in the jumper harness. This signal should go ON and OFF with the plow pump motor. The relay requires low power < 1 amp so most any signal will do without loading issues. The schematic shows the control terminals on the motor solenoid which is the most common connection point.
- b) Using a test lamp try various connection points on the plow control wiring to identify a signal that will illuminate the test lamp only when the motor is running.

Note:

- Some plows will present hot [B+] to both motor solenoid control terminals until one side goes to ground. As long as the lamp works right the jumper can be connected the same way. Connect the blunt cut red and black wires across the same signal source as was used to operate the test lamp. Normally the red wire will go to B+ and black to ground. [If both connection points are at B+ when the motor is at rest then put the black wire to the side that goes to ground when the motor runs and the red one to the constant B+ connection.]
- c) If the operating signal must be obtained outside of the engine compartment [on the plow itself] then <u>two sets</u> of inline connector will be required. [Order GM service kit, 2 each M 2W 19119346 and 2 each F 2W 19119765 connectors] Using 2 sets of connectors will allow tethered caps to be fashioned for when the plow is disconnected. Secure the wires and caps appropriately to assure durability. See figure 4.

General Motors Upfitter Integration


http://www.gmupfitter.com



Additional Reference Information

Fig 1: Jumper harness wiring schematic

VYU Service Harness for both single and dual generator trucks

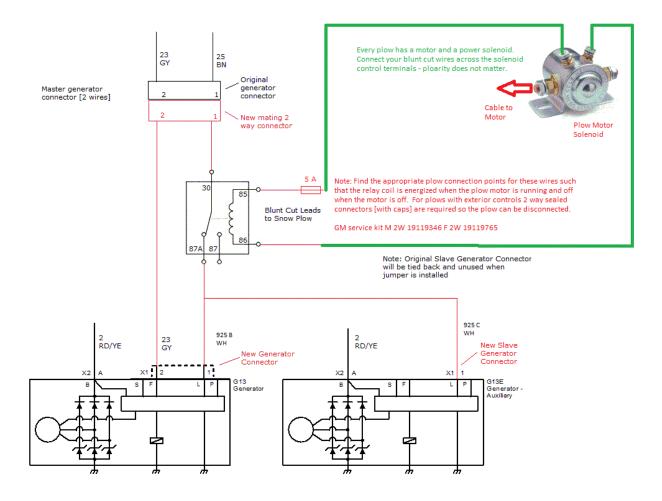


General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #124k P a g e 4 November 7, 2019



Note: To identify the signal needed by the jumper harness perform the following test. Any connection point that passes this test can be used. The best case is a signal from the wiring that remains with the truck but if that is not found then the signal must be found out on the plow itself.

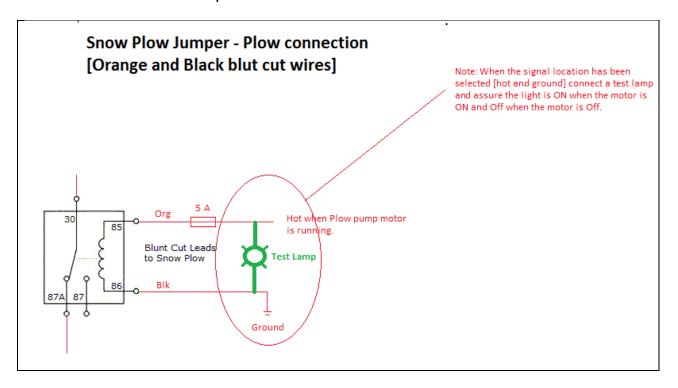


General Motors Upfitter Integration http://www.gmupfitter.com

Bulletin #124k Page 5 November 7, 2019



Fig: 2 Jumper Harness - Component Details

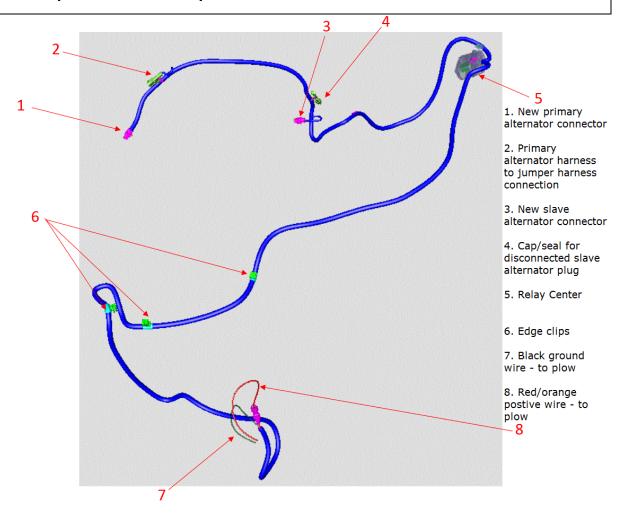


General Motors Upfitter Integration

http://www.gmupfitter.com



Fig: 3a Jumper Harness Layout – single alternator [see detail 3 for updated relay mounting]

VYU Single Alternator - Jumper Harness

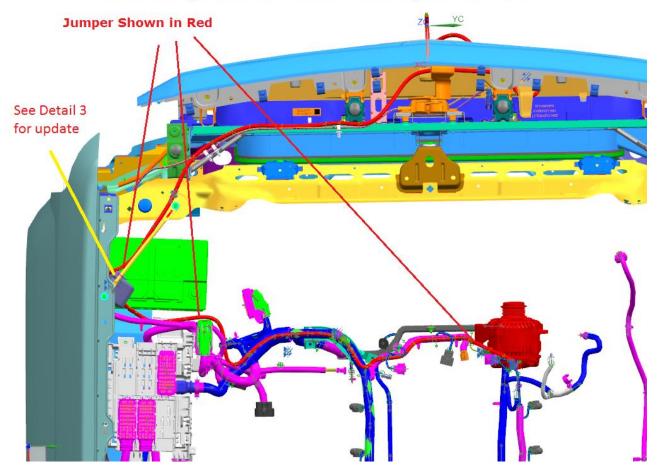

General Motors Upfitter Integration


http://www.gmupfitter.com

Bulletin #124k P a g e 7 November 7, 2019



Fig: 3b Jumper Harness Layout – dual alternator [see detail 3 for updated relay mounting]

VYU Dual Alternator - Jumper Harness

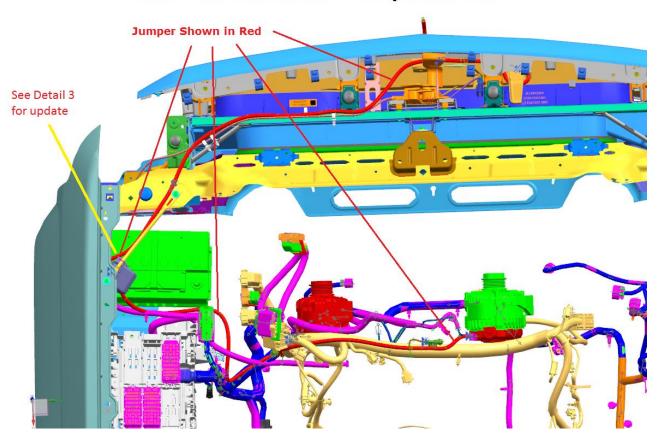

General Motors Upfitter Integration


http://www.gmupfitter.com

Bulletin #124k P a g e 8 November 7, 2019



Layout Details

- 1. Primary Alternator
- 2. Slave Alternator
- 3. Relay Center and [new] corner brace
- 4. Wires to plow [fused + & ground]

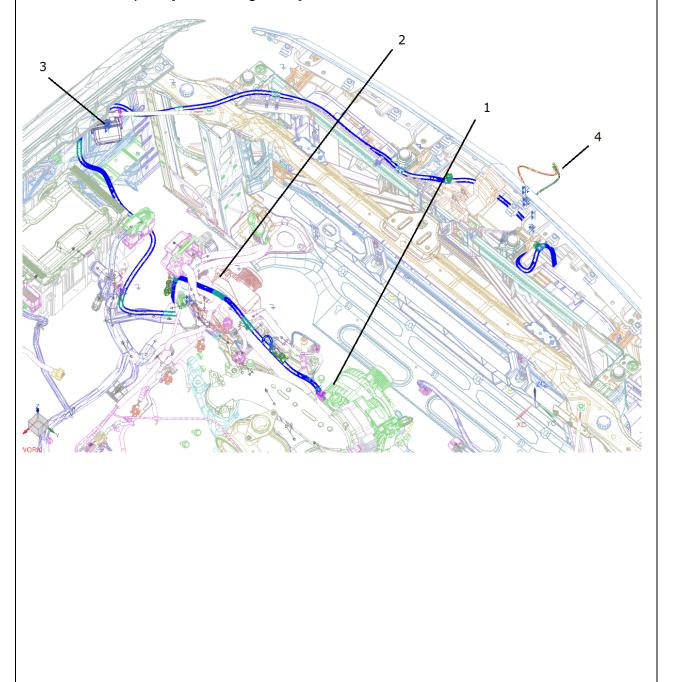


General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #124k P a g e 9 November 7, 2019



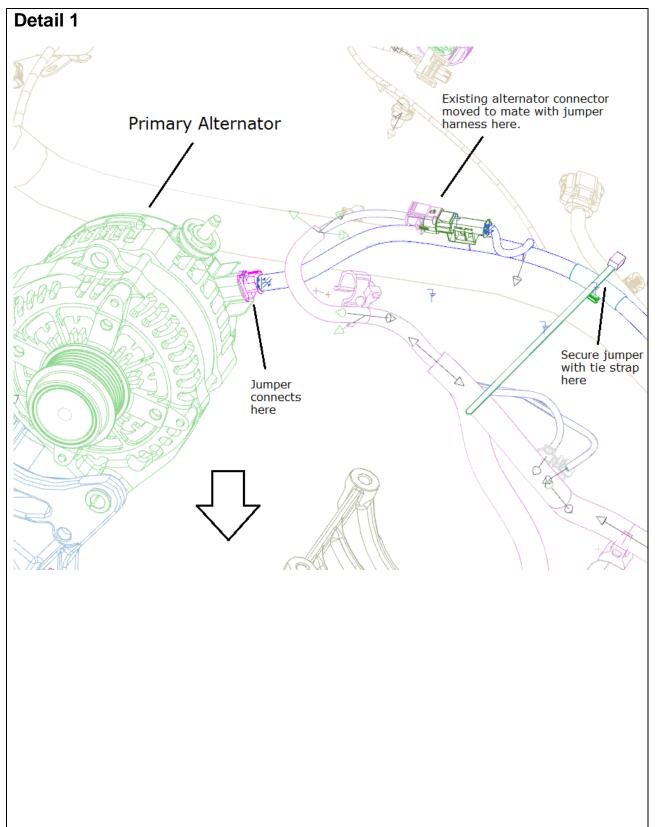


General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #124k P a g e 10 November 7, 2019



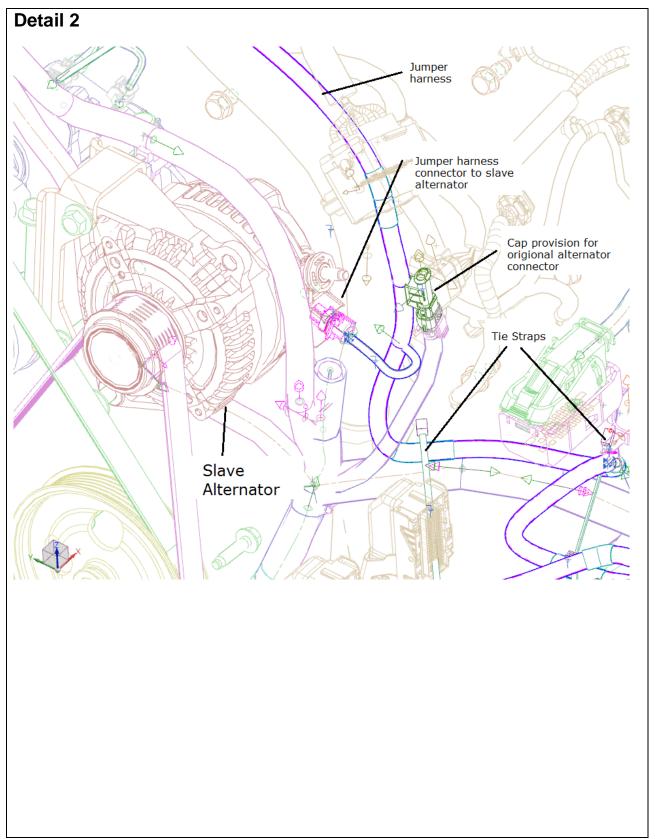

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #124k P a g e 11 November 7, 2019




Detail 3.1.1

Details 3.1.1-3 apply to service part and not the factory included [loose shipped] part.

See Details 3.2.1-7 for the later version factory harness that comes with a new truck.

Add tie straps to relay

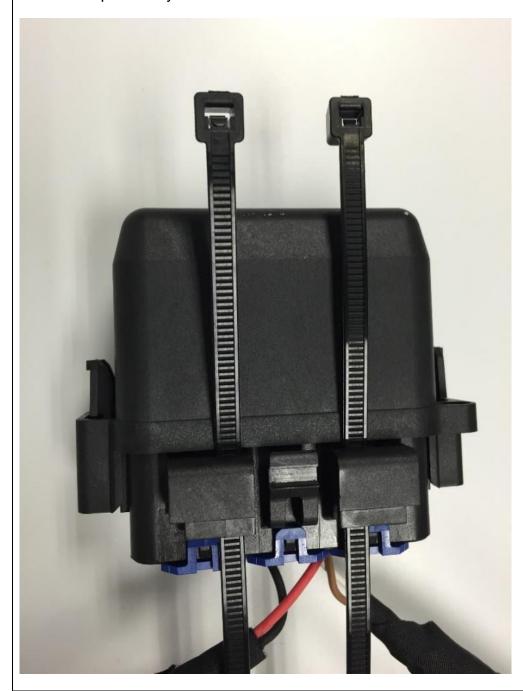

General Motors Upfitter Integration


http://www.gmupfitter.com

Bulletin #124k P a g e 12 November 7, 2019



Detail 3.1.2

Single Battery Trucks

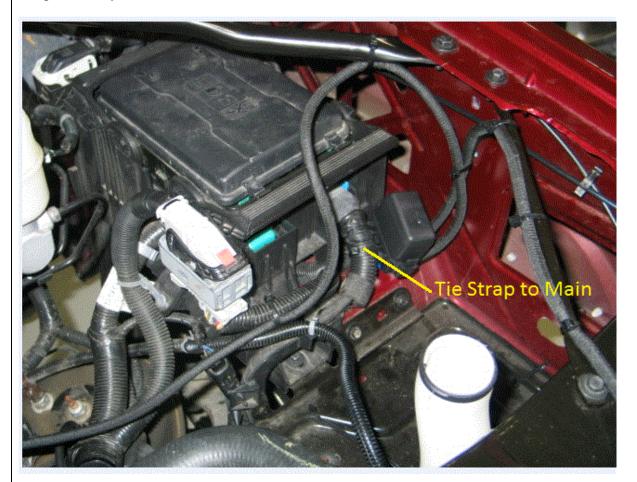

General Motors Upfitter Integration


http://www.gmupfitter.com

Bulletin #124k P a g e 13 November 7, 2019



Detail 3.1.3

Dual Battery Trucks

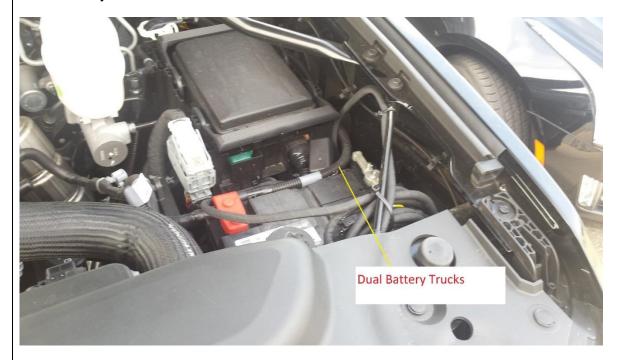

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #124k P a g e 14 November 7, 2019



Detail 3.2.1

The following details 3.2.1 – 7 apply only to trucks that came with harness components [loose shipped] from the assembly plant.

Remove the Radiator Air Upper Baffle and Deflector.



General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #124k P a g e 15 November 7, 2019



Detail 3.2.2

Identify the new flat painted corner brace pn 84234282. [unpainted version shown]



General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #124k P a g e 16 November 7, 2019



UI Bulletin #124k Detail 3.2.3 Relay center and bracket details.

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #124k P a g e 17 November 7, 2019



Detail 3.2.4

Remove the [round] left front corner brace shown here.



General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #124k P a g e 18 November 7, 2019



Detail 3.2.5

Assemble the relay bracket to the flat corner brace using hardware provided. Snap the relay bracket into the feature on the relay center.



General Motors Upfitter Integration


http://www.gmupfitter.com

Bulletin #124k P a g e 19 November 7, 2019



Detail 3.2.6

Position the corner brace and relay center assembly.

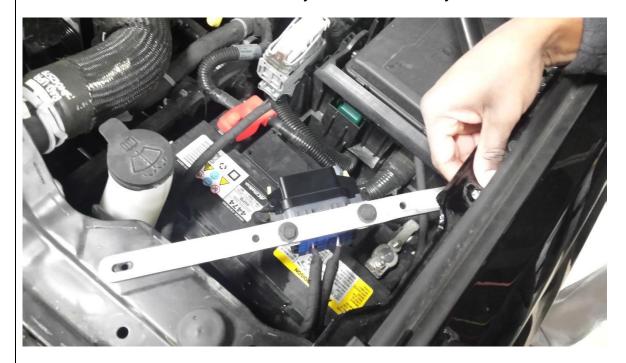

General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #124k P a g e 20 November 7, 2019



Detail 3.2.7

Mount the flat corner brace assembly as shown.



General Motors Upfitter Integration

http://www.gmupfitter.com

Bulletin #124k P a g e 21 November 7, 2019



Detail 4

On units were the control signal must be obtained out on the plow wiring. **Two sets of 2-way sealed connectors** will be required as shown here. Extra mating halves can be used to fashion tethered caps. [Order GM service kit, 2 each M 2W 19119346 and 2 each F 2W

19119765 connectors]

General Motors Upfitter Integration

http://www.gmupfitter.com