


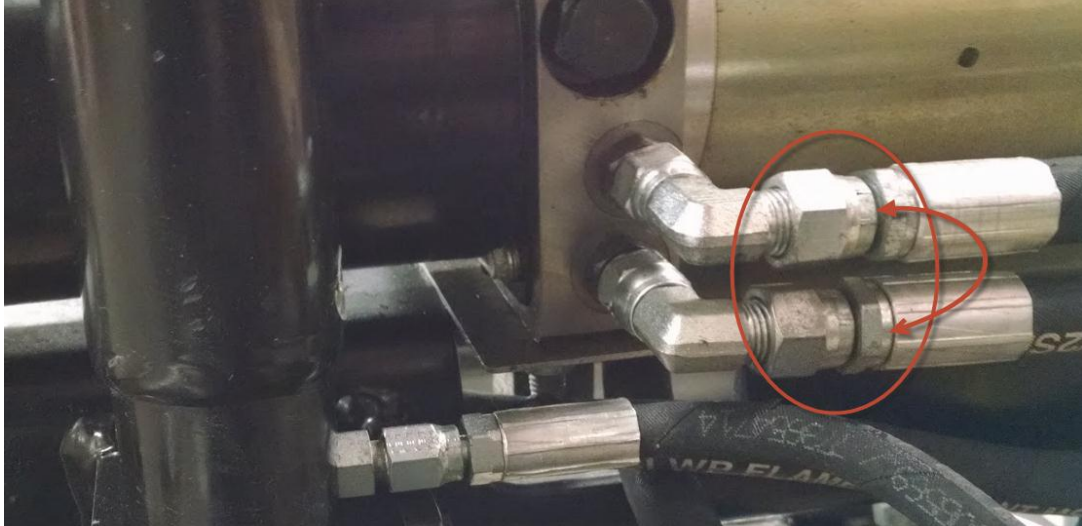

| | | | | | | | | |
|--------------------|---|----------|---------|---------------|------------------------------|----------------|----------|--|
| NUMBER | 16TSB-66 | | | TYPE | SERVICE/INSTALL ALERT | | | |
| ROUTING | INSTALL | X | SERVICE | X | SALES | | PURCH | |
| TITLE | STRAIGHT BLADE LEFT/RIGHT REVERSED | | | | | | | |
| REV | A | | | ISSUED | 11/11/2015 | REVISED | - | |
| AFFECTS | 1601100/16012000/16015000 - HD/EX/TE/MD PLOWS | | | | | | | |
| INFORMATION | SOME STRAIGHTBLADE PLOW ANGLE CYLINDER HOSES WERE PLUMBED INCORRECTLY AT ASSEMBLY. AS A RESULT, THE BLADE MOVES BACKWARDS. IT GOES LEFT WHEN RIGHT IS PRESSED, AND RIGHT WHEN LEFT IS PRESSED. | | | | | | | |
| DETECTION | THIS SHOULD BE DETECTED AT FIRST PLOW OPERATION AFTER INSTALL. | | | | | | | |
| CORRECTION | <p>THIS CAN BE CORRECTED BY SWAPPING THE HOSES ON THE POWER UNIT. SWAP THE UPPER AND LOWER ANGLE HOSES TO RESTORE PROPER FUNCTION TO THE PLOW.</p>  | | | | | | | |