


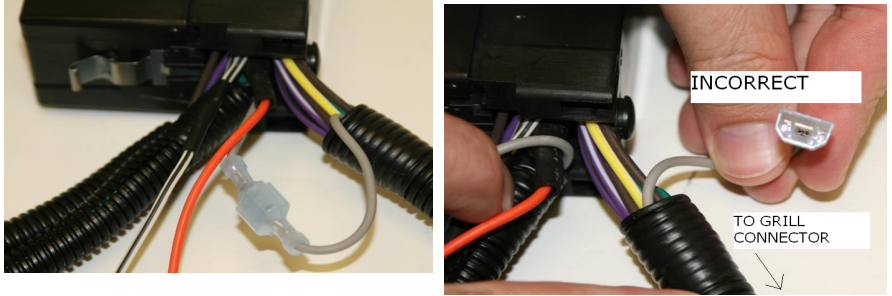

TECHNICAL SERVICE BULLETIN

NUMBER	TSB16-22	TYPE	INSTALLATION ALERT		
TITLE	RELAY HARNESS GRAY WIRE CONNECTORS				
REV	A	ISSUED	9/4/2009	REVISED	-
AFFECTS	16160100/B RELAY HARNESS, VARIOUS BUILD DATES. THIS ONLY AFFECTS SWITCHED GROUND APPLICATIONS.				
INFORMATION	THE MALE AND FEMALE QUICK CONNECTS ON THE GRAY WIRE OF A LIMITED NUMBER OF 16160100/B HARNESSES ARE BACKWARDS.				
IDENTIFICATION	<p>THIS SHOULD ONLY AFFECT NEWER HARNESSES BUILT ON OR AFTER 06/2009. THESE HARNESSES HAVE A SINGLE ORANGE WIRE AND A SINGLE WHITE WIRE WITH BLACK STRIPE EXITING THE RELAY MODULE. AN EXAMPLE IS SHOWN.</p> 				
INSTRUCTIONS	<p>THE GRAY WIRE THAT LEADS TO THE LARGE OVERMOLDED PLUG (THE LARGER OF THE THREE SLIT-LOOM CONDUITS) SHOULD HAVE A FEMALE QUICK CONNECT.</p> <p>THE DEALER MAY EITHER CONTACT BPC FOR A REPLACEMENT 16160100/B HARNESS</p> <p>-OR-</p> <p>REMOVE THE MALE QUICK CONNECT AND CRIMP A FEMALE QUICK CONNECT ONTO THE GRAY WIRE. THE OTHER SIDE IS NOT USED AND SHOULD BE TAPED OFF (PER THE INSTRUCTIONS)</p> 