


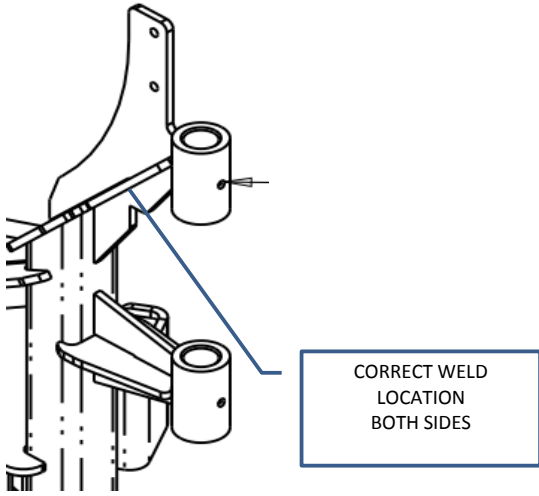

TECHNICAL SERVICE BULLETIN

NUMBER	16TSB-51	TYPE	SERVICE ALERT		
TITLE	2011 VMD A-FRAME				
REV	A	ISSUED	7/12/2012	REVISED	-
AFFECTS	VMD PLOW AFRAMES SOLD IN 2011-2012 SEASON				
INFORMATION	<p>SOME VMD A-FRAMES BUILT IN 2011 HAD MISSING WELDS, POTENTIALLY LEADING TO CRACKS IN THE HINGE TOWER. THE AFRAME WAS REDESIGNED IN EARLY 2012 TO ELIMINATE THIS ISSUE. THE NEWER DESIGN DOES NOT HAVE THE NOTCH SHOWN.</p>				
INSTRUCTIONS	<p>INSPECT THE A-FRAME FOR WELDS IN THE AREAS SHOWN BELOW. IF WELDS ARE ABSENT, WARRANTY FOR 1 HOUR OF LABOR IS AUTHORIZED FOR REPAIR. IF CRACKS ARE PRESENT, AFRAME REPLACEMENT IS AUTHORIZED. CONTACT YOUR DEALER OR SNOWDOGG TECH SUPPORT FOR FURTHER INFORMATION.</p> <div style="text-align: right; margin-top: 20px;">  <div style="border: 1px solid black; padding: 5px; display: inline-block; margin-left: 20px;"> CORRECT WELD LOCATION BOTH SIDES </div> </div>				